



SAFETY RECALL BULLETIN

SUBJECT:

FRONT SEAT BELT BUCKLE SAFETY RECALL

NO. SR-95-002

DATE October, 1995

MODEL 1986-1991 Models

PURPOSE

Mitsubishi Motor Sales of America, Inc. (MMSA) is voluntarily recalling certain 1986-1991 vehicles for inspection and repair of front seat belt buckle release buttons. A broken release button may prevent the buckle from latching or unlatching.

A letter is being sent to all affected vehicle owners over a ten month period telling them to return their vehicles to their Mitsubishi Motors dealer to have their front seat belt buckles repaired or replaced at no charge to the customer. A copy of this letter is shown on page 14 of this bulletin. Customer notification will be mailed according to the following schedule. Parts availability is based on this notification schedule.

Mailing Date	Model Years	Model
November 1995	1989	Galant
December 1995	1991	Eclipse
January 1996	1988-91	Montero
February 1996	1987-90	Van/Wagon
	1986	Galant
	1986	Cordia
March 1996	1988	Mirage
	1987	Galant
	1988-90	Sigma
	1987-88	Cordia
April 1996	1990	Eclipse
	1989	Mirage
May 1996	1987	Mirage
	1990	Mirage
	1987	Montero
June 1996	1987-91	Truck w/bucket seats
	1991	3000GT
	1986	Mirage
	1991	Mirage
July 1996	1987-88	Truck w/bench seat
August 1996	1986	Truck w/bucket and bench seats
	1989-91	Truck w/bench seats
	1986	Montero
	1986	Starion

Some parts will be automatically shipped to dealers during the first week of November and subsequent months through August 1996, in accordance with the customer notification schedule. If a customer has a broken seat belt buckle, replace the buckle assembly immediately regardless of the notification schedule.

047932

FILE UNDER:

Safety Recall Section of the Dealer Service Information Binder

(1407)

CIRCULATE TO:

☒ GENERAL MANAGER

☒ PARTS MANAGER

☒ TECHNICIAN

DETAILS

On 1989, 1990 and 1991 Mirages, the front seat lap belt buckle assemblies must always be replaced. On other affected vehicles, front seat belt buckles produced before January 1991 must be disassembled and a Buckle Repair Kit containing a new release button must be installed on both front seat buckles. The lot number on the buckle indicates the production date.

This recall does not include rear seat belts or the passive front shoulder belt portion of the seat belt assembly.

Mitsubishi training videotape #61, "Front Seat Belt Buckle Safety Recall" and its associated test booklet are included with this dealer recall package. Dealers are required to review the videotape and take the test. Follow the test booklet instructions.

VEHICLES AFFECTED

Certain 1986-1991 Mitsubishi models.

REQUIRED OPERATIONS

Perform the required operations on both front seat belts. The flowchart on page 4 shows the general description of the required operations. Details of the required operations are contained in the PROCEDURE section of this bulletin.

1. Check both front seat belt buckle lot numbers to determine whether either one is involved in this recall. It is possible that one of the buckles is a later model than the other one. Step 1 on page 6 of this bulletin describes how to determine the buckle production date.


IMPORTANT: Buckles produced after January 1991 are <u>not</u> included in this recall.

- a. If the buckle lot number is not within the affected production range, it is not necessary to perform buckle repair or replacement. If both front seat buckles are out of the affected production range, check for proper seat belt buckle operation, then complete a warranty claim for seat belt buckle inspection only.
2. For 1989, 1990 and 1991 Mirage models, replace the front lap seat belt buckle assembly. For bench seat center lap belt buckles on Trucks, replace the buckle assembly if the release button is broken or if the buckle does not operate properly.

For all other affected models:

3. Check the color of the seat belt buckle cover. If the cover is black, install a gray Buckle Repair Kit on both sides. Black Buckle Repair kits are not available.

4. Verify that the appropriate Buckle Repair Kit(s) are available before proceeding with this recall procedure.
 - On 1986-87 model years, note the color of the buckle ejector plate. A white ejector plate requires a different Buckle Repair Kit than a black ejector plate.
5. Disassemble the seat belt buckle.
6. Check for debris inside the buckle. If necessary, remove debris from inside the buckle with compressed air. Use low pressure air to prevent dislodging the springs. If debris cannot be removed, replace the seat belt buckle assembly as described in the appropriate service manual.
7. Check for contamination inside the buckle (from soft drinks, etc.). If contaminated, replace the seat belt buckle assembly as described in the appropriate service manual.
8. Replace the release button using the Buckle Repair Kit.
9. Check the seat belt buckle for proper operation. If the buckle does not latch or unlatch properly or the seat belt switch does not operate properly, then replace the buckle assembly as described in the appropriate service manual.
10. Confirm proper seat belt buckle and warning lamp operation.

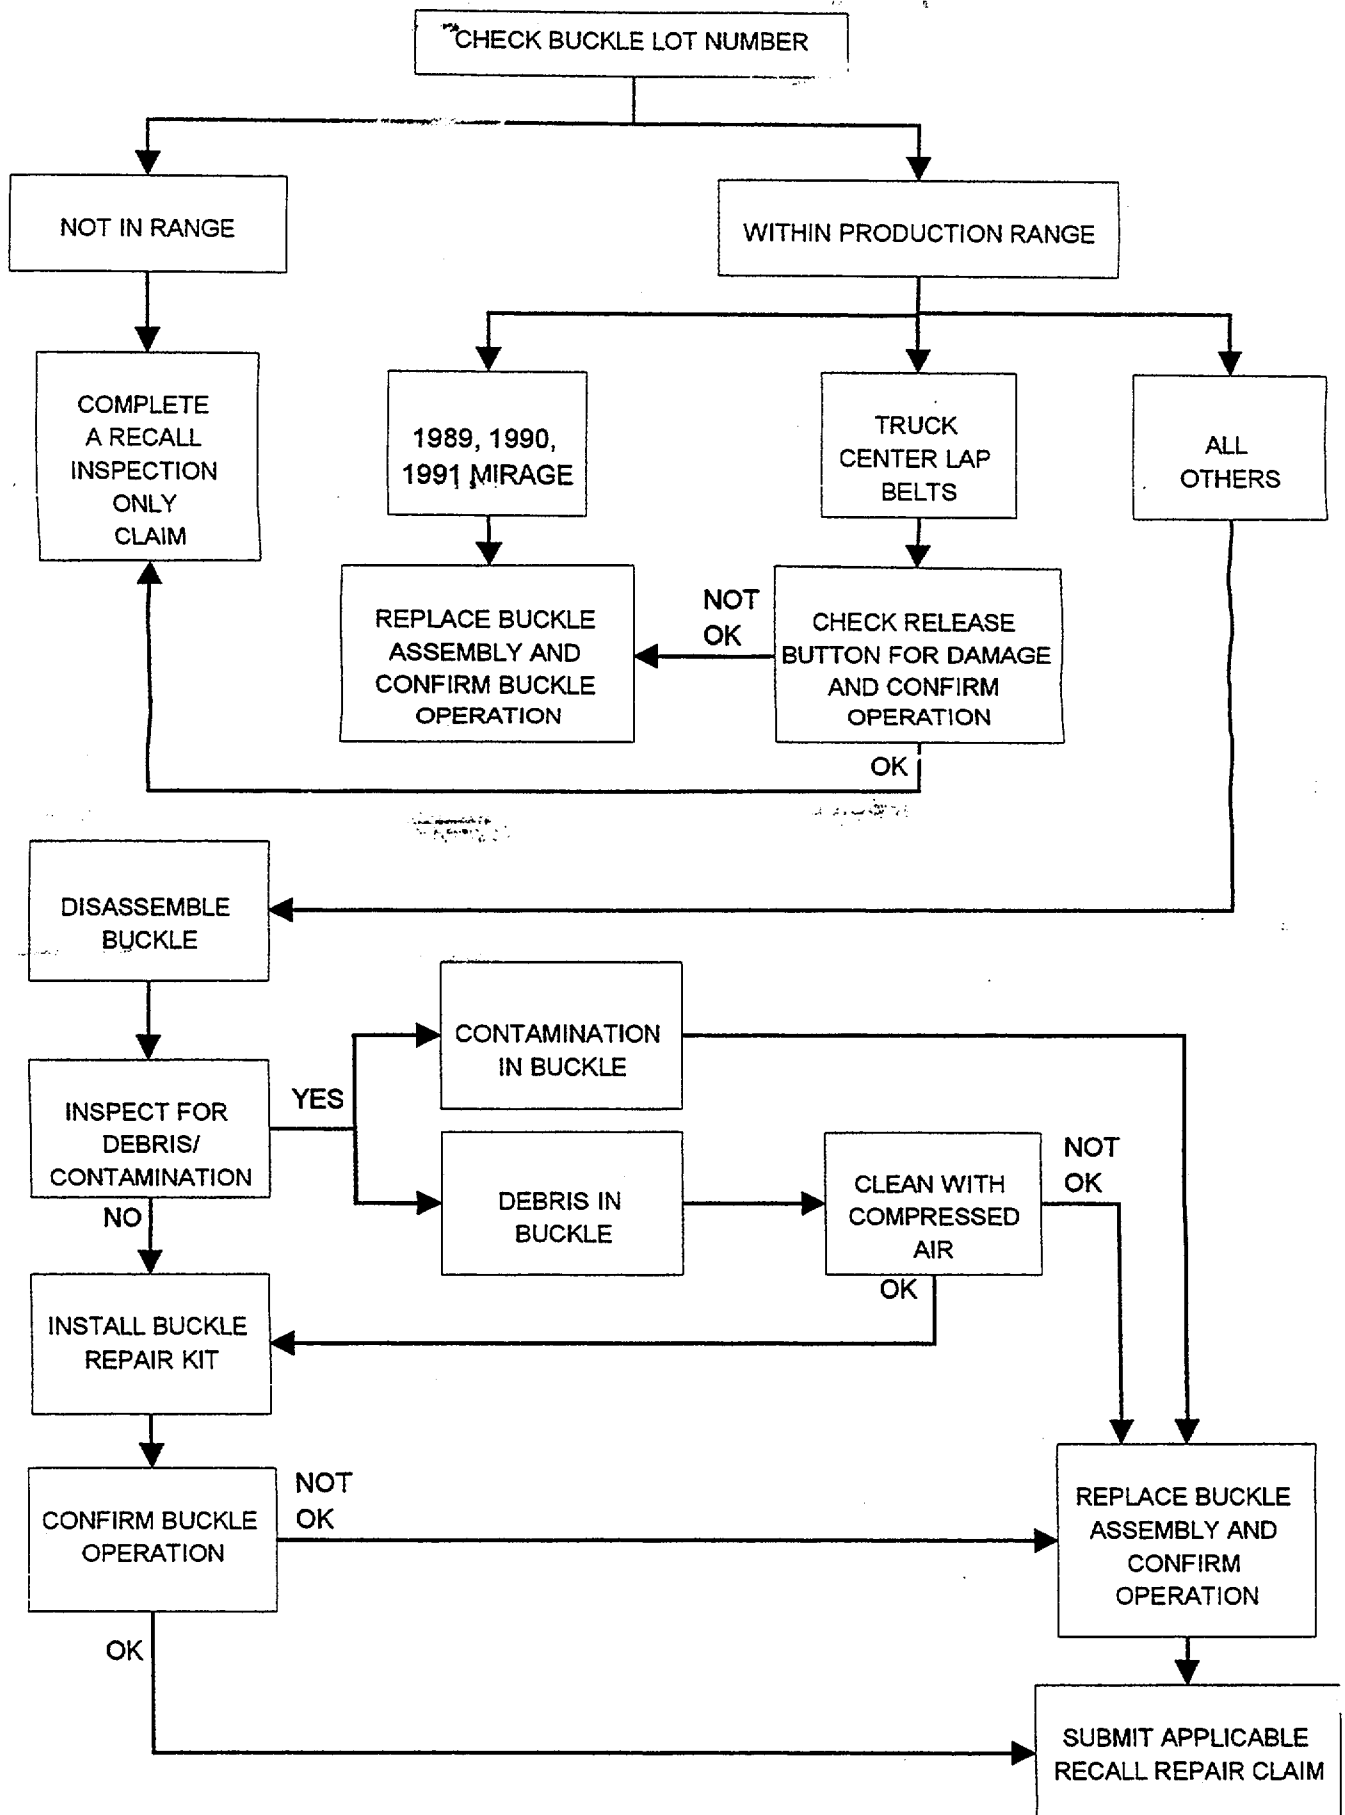

PARTS INFORMATION

Refer to Parts Bulletin TI-GP-02-95 for part number information.

- A Buckle Repair Kit contains a new release button, new upper and lower buckle covers, and a new latch spring for two front seat buckles. (Buckles with a white ejector plate do not have a latch spring. These repair kits will not include a spring.)
- Use gray repair kits for black seat belt buckles. Buckle repair kits for black buckles are not available.

Some parts will be automatically shipped to dealers during the first week of November and subsequent months through August 1996, in accordance with the customer notification schedule printed on page 1 of this bulletin. Refer to Parts Bulletin TI-GP-02-95 for details.

CAMPAIGN CLAIM AND WARRANTY INFORMATION

Campaign Labor Operation: **C9601TXX**

Labor Time Allowance: **See sample claims attached**

Sample claims are shown on Attachments 1 through 5 of this bulletin as follows:

- Attachment 1 - Diamond Net Warranty Menu screen
- Attachment 2 - *Inspection Only* claim
- Attachment 3 - *Two Buckle Repair Kits* claim
- Attachment 4 - *One buckle replacement with one Buckle Repair Kit* claim
- Attachment 5 - *Two buckle replacements* claim

If it is necessary to replace a retractor mechanism, the replacement must be claimed on a normal 'W' claim.

AND


A campaign claim must also be submitted as an "Inspection Only" claim in order to flag the VIN for campaign reporting purposes.

Seat belts covered by this recall will also be covered by a **limited, lifetime warranty** governed by the same warranty limitations and conditions as set forth for warranty coverage for 1996 model year MMSA vehicles.

PROCEDURE

Perform the following procedures on both front seat belts (not rear or shoulder belts).

1. Determine whether the buckle is within the production range for this recall:
Depress the seat belt buckle release button and check the lot number on the inside of the buckle as shown. The lot number is comprised of five characters.

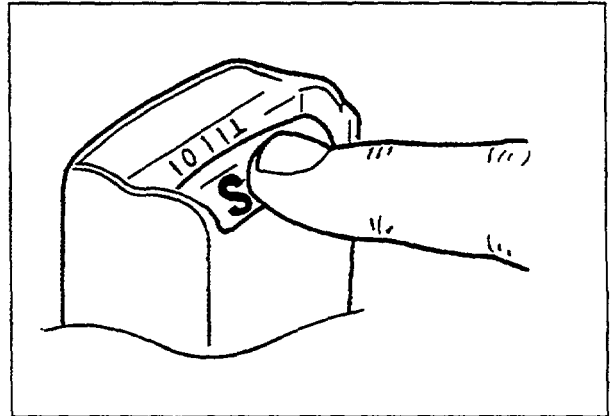

Disregard the "T" or "K" at the beginning or end of the lot number. The second and third characters indicate the production year and month respectively. (The last two numbers are lot order numbers.)
(Character "X" indicates October; "Y" indicates November; and "Z" indicates December production.)

Buckles produced after January 1991 are not included in this recall.

EXAMPLE: YEAR MONTH

T1101 = production date 1991, January

K9Y21 = production date 1989, November

- a. If the buckle production date is after January 1991, check for proper buckle operation. Then complete a campaign (C) claim for seat buckle inspection only. Do not continue with this campaign procedure. Refer to the sample claim on Attachment 2.
2. a. For 1989, 1990 and 1991 Mirages, replace the seat belt buckle assembly as described in the appropriate service manual. Repair kits are not available for these buckles. Refer to sample claim on Attachment 5.
b. For bench seat center lap belt buckles on Trucks, replace the buckle assembly if the release button is broken or if the buckle does not operate properly.

For all other affected models:


3. Check the color of the seat belt buckle cover. If the cover is black, install a **gray** Buckle Repair Kit on both sides. (Black Buckle Repair kits are not available.)
4. On 1986 and 1987 models, note the color of the buckle ejector plate. A white ejector plate requires a different Buckle Repair Kit.

Refer to Parts Bulletin TI-GP-02-95. Verify that the appropriate Buckle Repair Kit(s) are available before proceeding with this procedure.


The following tools are required for installing the Buckle Repair Kit:

- Large wire cutters
- Small flat ground wire cutters (such as Snap-On E710SCG or Radio Shack 64-1833)
- Medium screwdriver
- Small (miniature) screwdriver

5. On Truck center seat belts, using a small flashlight, inspect the release button for damage and proper operation.
 - a. If the release button is broken (cracked or chipped) or the buckle does not latch and unlatch properly, replace the buckle assembly as described in the appropriate service manual. Do not continue with this repair procedure.
 - b. If release button is OK, go to Step 6.

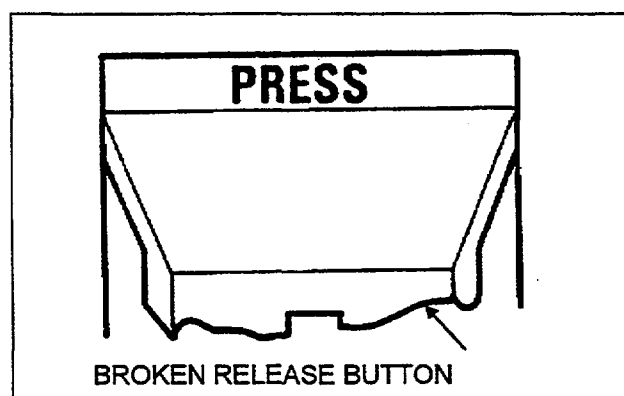


6. For Truck models with a bench seat:
 - a. Slide the front seat forward.
 - b. Remove the buckle anchor bolt.
 - c. For driver's side buckles, disconnect the warning lamp switch.
 - d. Remove the buckle assembly from the vehicle. The outer cover of the buckle assembly will need to be moved down on the webbing for access to the buckle.
 - e. For ease of cover reinstallation, wrap a wire through the bolt hole as shown.
 - f. Remove the buckle from the buckle cover until the entire buckle is exposed.

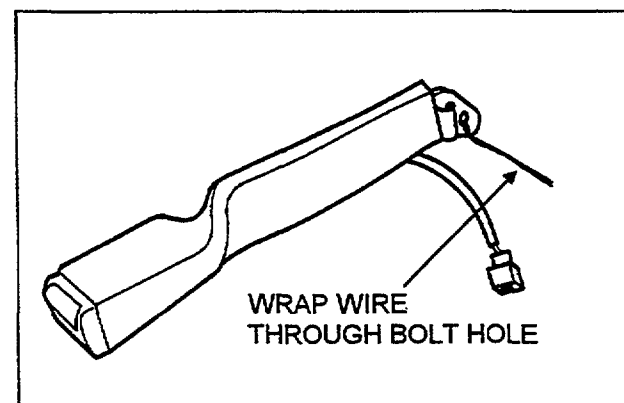


7. For all models with reclining seats, recline the seat all the way back.
8. Place a clean cloth on the seat around the buckle to protect the seat from accidental damage during the repair.
9. Remove the buckle cover as follows:

- a. Using a large pair of wire cutters, carefully cut both sides of the top of the upper buckle cover as shown. Remove the cut section of the bottom cover. It is important to angle the cut as shown, to allow for a gap in the buckle through which a screwdriver can be inserted.

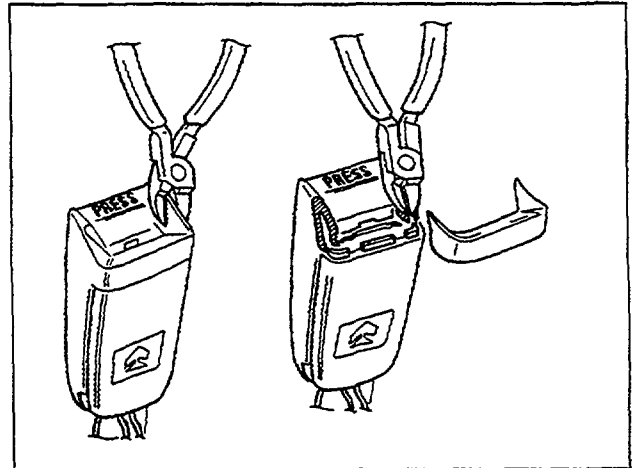


- b. Using a medium screwdriver, carefully separate the two halves of the buckle cover by prying between the edges of the top and bottom cover as shown.

CAUTION: Do not pry in the middle of the buckle.

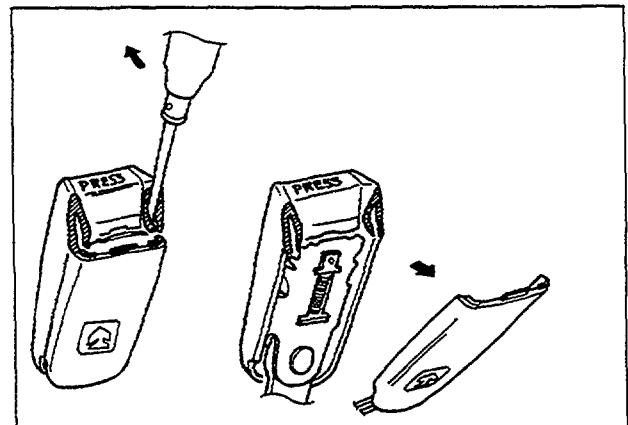


NOTE: For seat belts that do not have a switch in the buckle, skip Step 10.

10. For buckles with switches, use small wire cutters to remove the switch as follows:
 - a. Cut and remove the plastic tab at the bottom of the switch.
 - b. Slide the switch down.
 - c. Cut and remove the two tabs at the top of the switch.
 - d. Remove the switch by gently lifting the upper edge with a small screwdriver.

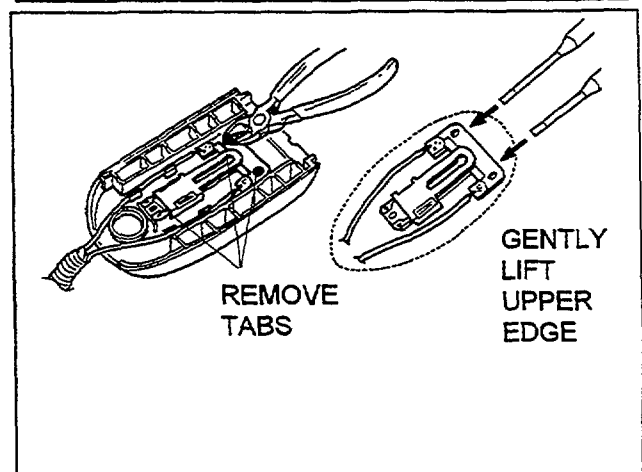

CAUTION: Use care to avoid damaging the wires or switch.

11. Remove the upper buckle cover.
12. For buckles with a black ejector plate, depress the seat belt release button and use a small screwdriver to remove the latch spring from the buckle side.

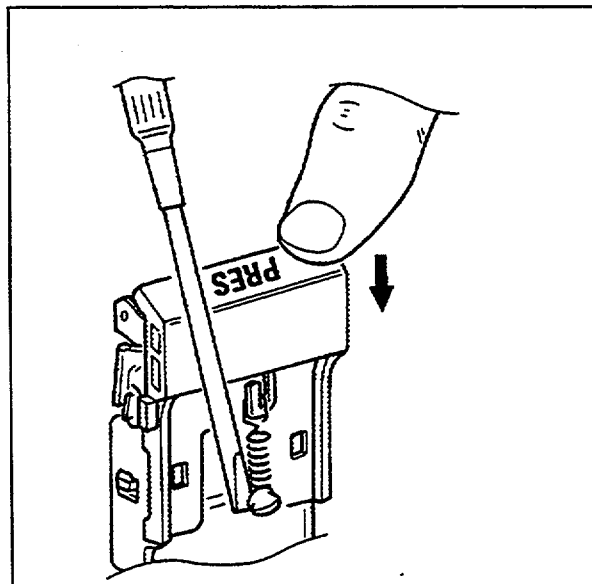


13. Remove the release button and spring as follows:
 - a. Depress and hold the release button.
 - b. Applying a slight upward force, tilt the lower half of the button away from the buckle and slide it out.
- NOTE:** Use care to avoid removing the spring holder.
14. Check for debris inside the buckle. If necessary, remove debris from inside the buckle with low pressure compressed air. If the debris cannot be easily removed, replace the buckle assembly as described in the appropriate service manual. Do not install a Buckle Repair Kit.
15. Check for sticky material contamination (such as spilled soft drink) inside the buckle. If the inside of the buckle is contaminated, replace the buckle assembly as described in the appropriate service manual.
16. Select the correct Buckle Repair Kit as listed in Parts Bulletin TI-GP-02-95. The Buckle Repair Kit contains a new release button, new upper and lower buckle covers, and a new latch spring for two front seat buckles. (Buckles with a white ejector plate do not have a latch spring. These repair kits will not include a spring.)


17. Position the springs and spring holder as shown.

18. Slide the new release button onto the buckle frame.


- a. For buckles with a white ejector plate, align the release button with the buckle and press it into place.

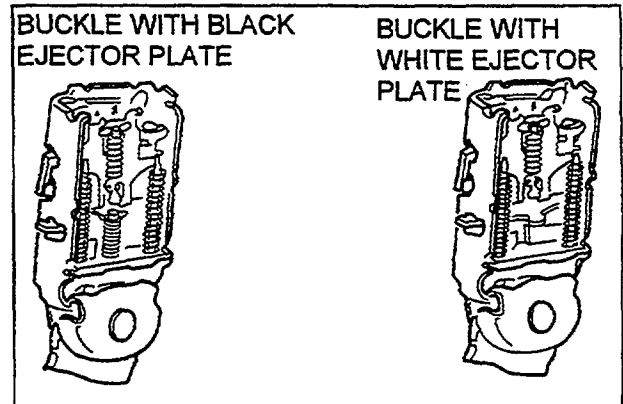

- b. For buckles with a black ejector plate, while depressing the button, use a small screwdriver to attach the latch spring.

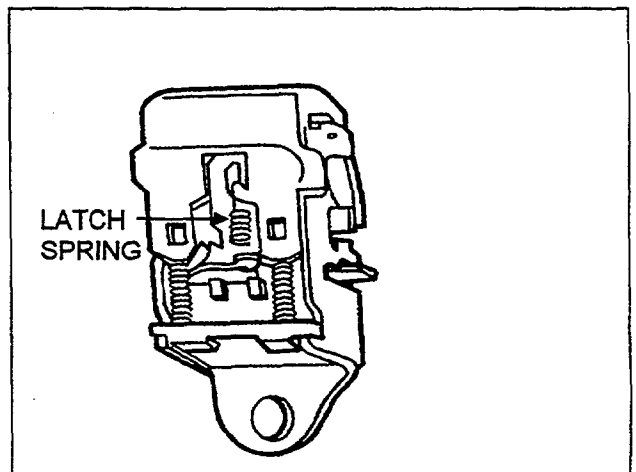

- c. Ensure that the spring and spring holder are attached correctly. Both springs should be set securely, with the spring holder claw caught against the buckle assembly as shown.

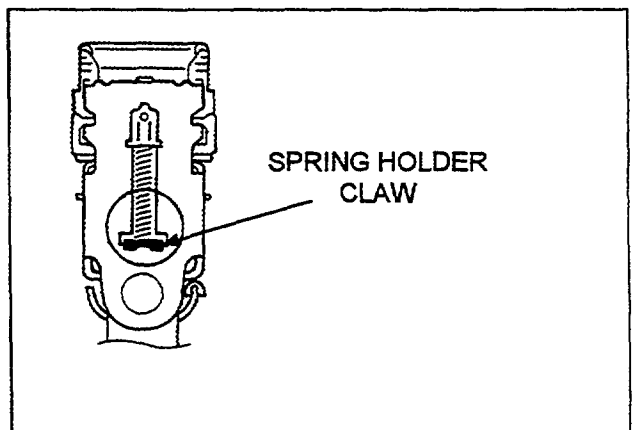


19. Test the release button operation for proper latching and unlatching operation:

- a. Insert the seat belt "tongue" into the buckle.
- b. Listen for a locking (clicking) sound when the tongue latches in the buckle.
- c. While firmly holding the buckle, pull on the seat belt tongue.


- d. Press the release button. The tongue should be pushed out by the ejector plate. You should not have to pull it out.
 - e. Repeat steps a. through d. three times.
 - f. If the buckle does not latch or unlatch properly, replace the buckle assembly as described in the appropriate service manual.
20. Install the new upper buckle cover. The cover should fit firmly around the buckle mechanism.
21. For buckles without a switch, go to Step 22. For buckles with a switch, reinstall the switch as follows:
- a. Slide the switch into the bottom cover, then gently press the top corners of the switch plate until they snap into place.

CAUTION: Do not apply pressure to the middle of the switch. If the switch is broken from applying pressure to the middle of the switch, the entire buckle assembly must be replaced.

- b. Carefully route the switch wires into the clamps as shown.
- c. Slide the switch upwards (away from the wires).

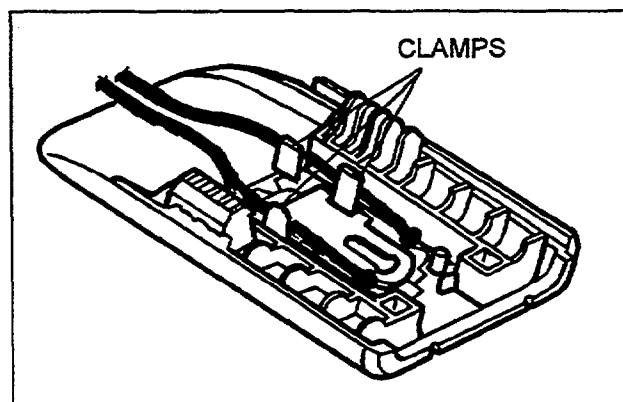

- d. While depressing the release button, align the hole in the switch slider with the dowel pin on the ejector in the lower cover as shown.

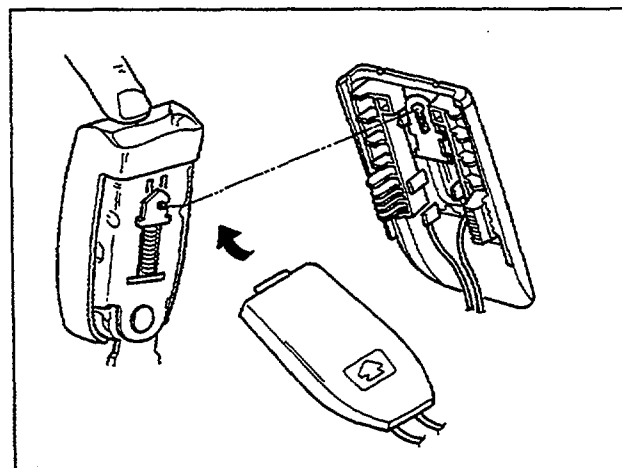

22. Install the new lower buckle cover. Be sure the cover snaps closed on all sides.

23. Test the buckle again for proper latching and unlatching operation:
 - a. Insert the seat belt "tongue" into the buckle.
 - b. Listen for a locking (clicking) sound when the tongue latches in the buckle.
 - c. While firmly holding the buckle, pull on the seat belt tongue.
 - d. Press the release button. The tongue should pop out without dragging. You should not have to pull it out.
 - e. Repeat steps a. through d. three times.
 - f. If the buckle does not latch or unlatch properly or the seat belt switch is broken, replace the buckle assembly as described in the appropriate service manual.
24. For Truck models with a bench seat, reinstall buckle assembly as follows:
 - a. Using the wire previously installed in the bolt hole, pull the buckle back into the buckle cover.
 - b. Remove the wire from the bolt hole.
 - c. Reinstall the buckle into the vehicle. Torque the anchor bolt to 35 - 55 Nm (25 - 40 ft. lbs.)
 - d. Reconnect the seat belt warning lamp switch.
25. Confirm operation of the seat belt warning lamp. If necessary, repair as described in the appropriate service manual.
26. Complete a campaign warranty claim for seat belt buckle repair kit. Refer to the sample claim on Attachment 3 of this bulletin.

Produced by the MMSA Technical Information Department.
--



6400 KATELLA AVENUE
CYPRESS, CALIFORNIA 90630-5201
(714) 372-6000 (310) 493-1231
TELEFAX (714) 373-1021
TELEX 68345

MAILING ADDRESS
P.O. BOX 640
CYPRESS, CALIFORNIA 90630-006

TSB NUMBER: SR-95-002
CAMPAIGN NUMBER: C9501TXX

Date

VIN

Customer Name

Address

Address

IMPORTANT SAFETY RECALL NOTICE

Dear Mitsubishi Owner:

This notice is sent to you by Mitsubishi Motor Sales of America, Inc. ("MMSA") in accordance with the defect provisions of the National Traffic and Motor Vehicle Safety Act.

MMSA has determined that some front seat belt release buttons have broken in certain 1986-1991 model year Mitsubishi-brand vehicles, and that some of their release buttons may break in the future. Your front seat belt buckle release buttons are made of red plastic and are marked "PRESS". If the button breaks, pieces may fall into the buckle assembly. If this occurs, the buckle may not operate properly, thereby creating a safety risk.

To prevent this problem from occurring, MMSA will replace the release button in both front seat belt buckles free of charge, whether or not they are broken.

In addition, MMSA is extending the current warranty on the front seat belts in your vehicle (including the center lap belts in pickup trucks) for the life of the vehicle. See your warranty booklet for details. This means that if any conditions covered by the seat belt warranty are found at any time now or in the future, your Mitsubishi dealer will correct these conditions free of charge. Please keep this letter with your warranty materials for the vehicle.



Page 14 of 14
(SR-95-002)

It is very important that you schedule your Mitsubishi for button replacement as soon as possible, after you receive this notice (the notices to owners are being mailed in a phased manner, to maximize parts availability). If your seat belt buckle doesn't operate properly, you might not be able to use your seat belt until it is repaired. Seat belt use is required by law in almost all states. Also, if you do not use your seat belt, and you are in a collision, your chances of being killed or seriously injured are much higher than if you are wearing your seat belt. MMSA urges you to use your seat belt at all times, and to contact your dealer immediately for button replacement, especially if you notice that a button is broken or if you experience any problems with seat belt operation. Even if the buttons are not broken, they should be replaced.

WHAT YOU SHOULD DO

Contact your Mitsubishi dealer and make an appointment for replacement of your front outboard seat belt release buttons. The dealer will replace both front seat belt release buttons free of charge. This replacement will take approximately 2 hours, but your dealer may require your vehicle for a longer period of time based on their work schedule. If your vehicle is a pickup truck with a center lap belt, the dealer will inspect its buckle and, if necessary, replace it. Please bring this notice with you when you keep your service appointment. Instructions have been sent to your Mitsubishi dealer. If the dealer fails, or is unable to make the necessary repairs free of charge, you may contact the Customer Service Department, Mitsubishi Motor Sales of America, Inc., P.O. Box 6400, Cypress, CA 90630-0064. The toll free telephone number is 1-800-222-0037.

You may also contact the Administrator of the National Highway Traffic Safety Administration, 400 Seventh Street, S.W., Washington, D.C. 20590 or call the toll free auto safety hotline at 1-800-424-9393. (Washington, D.C. area residents may call 202-366-0123).

Thank you for your cooperation. We are indeed sorry for any inconvenience you might experience.

Sincerely,

George C. Croker
Manager, National Customer Service

SAMPLE SEAT BELT CAMPAIGN CLAIMS:

99999 MITSUBISHI DIAMOND NETWORK 09/15/95

WARRANTY MENU

SEL	DEALER DATA ENTRY	SEL	MMSA RESPONSES & REPORTS
---	-----	---	-----
E1	PDI (P)	R1	DATA ENTRY ACKNOWLEDGEMENT
E2	MWC (W)	R2	CLAIM CORRECTION REPORT
E3	TCR (T) (N/A)	R3	WARRANTY STATEMENT (DAILY)
E4	PRODUCT MODIFICATION (X)	R4	WARRANTY STATEMENT (MONTHLY)
E5	RECALL CLAIM (C)	R5	WARR STATEMENT (MON-TO-DATE)
E6	OPT EQUIPMENT REC (G)	R6	ADVANCE ENTERED PWA REPORT
E7	CLAIM CORRECTION	R7	WARRANTY MATERIAL RETURN RPT
E8	APPEAL OF ADJUSTED AMOUNT CLAIM	R8	WARRANTY MATERIAL SCRAP RPT
E9	WARRANTY RATE PARAMETERS	R9	WARRANTY CONTROL REPORTS
E10	ADVANCE PWA CLAIM COMPLETION		
E11	VEHICLE INFORMATION REQUEST	SEL	MMSA ON-LINE FUNCTIONS
E12	AUDIO CODE REQUEST	---	-----
E13	TECHNICIAN CODE INFO. ENTRY	R51	SERVICE ON-LINE MENU
E14	SERVICE ADVISOR INFO. ENTRY		

ENTER SELECTION
MODE ADD
F1-HELP F2-XPLN F3-HOW F4-PRT F5-ADD F6-BRS F7-CHG F8-CAN F9-SEL F10-RETN

ENTER UNDER MENU OPTION 'E-5'



SAMPLE CLAIMS -

- INSPECTION ONLY - NO REPAIR NEEDED
- 2 BUCKLE REPAIR KITS
- 1 BUCKLE ASSEMBLY & 1 BUCKLE REPAIR KIT
- 2 BUCKLE ASSEMBLY REPLACEMENTS

SAMPLE CLAIM: INSPECTION ONLY

WE5D		MITSUBISHI DIAMOND NETWORK		09/15/95	
99999				TOTAL 1	
		RECALL CLAIM		PAGE 1	
CLAIM NO. [N0007]					
REPAIR DATE		-----VIN-----		-----PWA-----	
10/15/95		JA.....		DSM SEQ REASON MILEAGE	
				78903	
LINE	PART NUMBER	QTY	PARTS COST	SUB OPERATION	LBR LABOR QTY HOURS AMOUNT DELETE
A	X	0	.00	C9601TXX	1 .2 ??.
B					
C					
D					
E					
F					
G					
H					
I					
J					
PARTS TOTAL		.00		LABOR TOTAL ??.	
ENTER SELECTION					
MODE BROWSE					
F1-HELP F2-XPLN F3-HOW F4-PRT F5-ADD F6-BRS F7-CHG F8-CAN F9-SEL F10-RETN					

LABOR FOR INSPECTION
OF BOTH SIDES WITH
NO REPAIRS NEEDED

MODEL	LABOR TIME
MIRAGE	.2
VAN/WAGON	.2
TRUCKS (BUCKETS)	.2
TRUCKS (BENCH)	.2
MONTERO	.2
3000GT	.2
ECLIPSE	.2
STARION	.2
SIGMA	.2
GALANT	.2
CORDIA	.2

**Note: Inspection only labor
time is .2 hr for all models**

SAMPLE CLAIM: 2 BUCKLE REPAIR KITS

WE5D 99999		MITSUBISHI DIAMOND NETWORK				12/15/95	
		RECALL CLAIM				TOTAL	1
CLAIM NO. IN00071						PAGE	1
REPAIR DATE 09/15/95		VIN JA.....		DSM SEQ	REASON	MILEAGE 78903	
-----PWA-----							
LINE	PART NUMBER	QTY	PARTS COST	CAMPAIGN SUB OPERATION	LBR QTY	LABOR HOURS	LABOR AMOUNT DELETE
A	X MXXXXXXXX	2	XX.XX	C9601TXX	1	.?	??.??
B							
C							
D							
E							
F							
G							
H							
I							
J							
PARTS TOTAL			.00	LABOR TOTAL		22.50	
ENTER SELECTION							
MODE BROWSE							
F1-HELP F2-XPLN F3-HOW F4-PRT F5-ADD F6-BRS F7-CHG F8-CAN F9-SEL F10-RETN							

ENTER THE REPAIR KIT PART
NUMBER APPLICABLE TO THIS
MODEL VEHICLE. (SEE LISTING
IN HIS BULLETIN)

LABOR SHOWN
IS FOR DOING
BOTH SIDES

MODEL	LABOR TIMES
MIRAGE	.4
VAN/WAGON	.4
TRUCKS (BUCKETS)	.3
TRUCKS (BENCH)	.4
MONTERO	.3
3000GT	.3
ECLIPSE	.3
STARION	.3
SIGMA	.3
GALANT	.3
CORDIA	.3

C9601TXX

SAMPLE CLAIM: 1 BUCKLE ASSEMBLY AND 1 BUCKLE REPAIR KIT

WESD		MITSUBISHI DIAMOND NETWORK				12/15/95	
99999						TOTAL	1
		RECALL CLAIM				PAGE	1
CLAIM NO. IN00071							
REPAIR DATE		-----VIN-----		-----PWA-----		MILEAGE	
09/15/95		JA.....		DSM SEQ REASON		78903	
LINE	PART NUMBER	QTY	PARTS COST SUB	CAMPAIGN OPERATION	LBR QTY	LABOR HOURS	LABOR AMOUNT DELETE
A	X MXXXXXXXX	1	XX.XX	C9601TXX	1	.?	??.??
B	MXXXXXXXX	1	XX.XX				
C							
D							
E							
F							
G							
H							
I							
J							
PARTS TOTAL			.00	LABOR TOTAL			22.50
ENTER SELECTION							
MODE BROWSE							

ENTER THE PART NUMBERS FOR 1 BUCKLE ASSY AND 1 KIT APPLICABLE TO THE VEHICLE . (SEE LIST IN THIS BULLETIN)

LABOR SHOWN IS FOR DOING BOTH SIDES

MODEL	LABOR TIMES
-------	-------------

MIRAGE	.4
VAN/WAGON	.4
TRUCKS (BUCKETS)	.3
TRUCKS (BENCH)	.4
MONTERO	.3
3000GT	.4
ECLIPSE	.4
STARION	.4
SIGMA	.4
GALANT	.4
CORDIA	.4

SAMPLE CLAIM: 2 BUCKLE ASSEMBLY REPLACEMENTS

WESD 99999		MITSUBISHI DIAMOND NETWORK				12/15/95			
RECALL CLAIM				TOTAL		1			
CLAIM NO. IN0007J				PAGE		1			
REPAIR DATE 09/15/95		VIN JA.....		DSM SEQ REASON		MILEAGE 78903			
				-----PWA-----					
LINE	PART NUMBER	QTY	PARTS COST	SUB	CAMPAIGN OPERATION	LBR QTY	LABOR HOURS	LABOR AMOUNT	DELETE
A	X MXXXXXXXX	2	XX.XX		C9601TXX	1	.?	??.??	
B									
C									
D									
E									
F									
G									
H									
I									
J									
PARTS TOTAL			.00	LABOR TOTAL			22.50		
ENTER SELECTION									
MODE BROWSE									
F1-HELP F2-XPLN F3-HOW F4-PRT F5-ADD F6-BRS F7-CHG F8-CAN F9-SEL F10-RETN									

ENTER THE BUCKLE ASSY PART
NUMBER APPLICABLE TO THIS
MODEL VEHICLE.
(SEE LISTING IN THIS BULLETIN)

LABOR SHOWN
IS FOR DOING
BOTH SIDES

MODEL	LABOR TIMES
MIRAGE	.5
VAN/WAGON	.5
TRUCKS (BUCKETS)	.3
TRUCKS (BENCH)	.4
MONTERO	.3
3000GT	.6
ECLIPSE	.6
STARION	.6
SIGMA	.6
GALANT	.6
CORDIA	.6

C9601TXX